Drawings


EJX510A, EJX610A, EJX530A and EJX630A Absolute and Gauge Pressure Transmitter

DP harp **EJ**

SD 01C25F01-01E

[Style EJX510A, EJX530A: S2, EJX610A, EJX630A: S1]

Unit: mm (approx. inch)

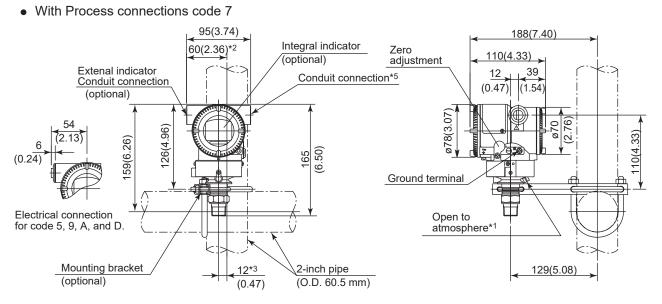

*1: Only for EJX530A and EJX630A whose measurement span code is A, B, or C.

*2: 58 mm(2.28 inch) for measurement span code D.


*3: 11 mm(0.43 inch) for measurement span code D.

*4: When electrical connection code 7 or C is selected, a blind plug is protruded up to 8 mm from the conduit connection.

- *5: When option code PP is selected, a blind plug is attached to the conduit connection on both sides.
- With Process connections code 4




With Process connections code 8 and 9





• Terminal Configuration

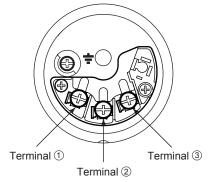

•	Terminal	Wiring
---	----------	--------

		-
SUPPLY	+ -	$\begin{bmatrix} 1\\ 2 \end{bmatrix}$ Power supply and output terminals
CHECK	+ -	$\begin{bmatrix} 3\\ 2 \end{bmatrix}$ External indicator (ammeter) terminals ^{*1*2}
or ALARM	+ -	③ ☐ Status contact output terminals ^{*2} ② ☐ (when /AL is specified)
Ground terminal		

*1: When using an external indicator or check meter, the internal resistance must be 10 Ω or less. A check meter or indicator cannot be connected when /AL option is specified.

*2: Not available for FOUNDATION Fieldbus and PROFIBUS PA communication types.