

Drawings

EJX510A, EJX530A and EJX630A Absolute
and Gauge Pressure Transmitter with
Process Connection Code W


DPharp EJX™

SD 01C25F01-11EN

[Style EJX510A, EJX530A: S2, EJX630A: S1]

Unit: mm (approx. inch)

• With Process connections code W *1

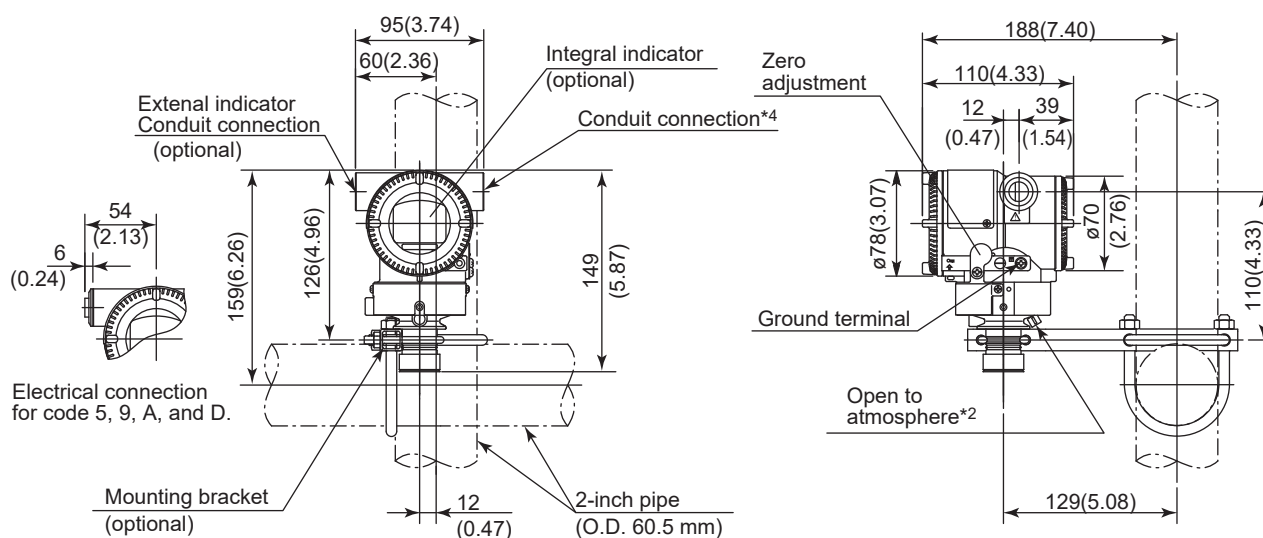

*1: Process connection code W is for combination with the third party's diaphragm seal.


Not applicable with measurement span code C or D.

*2: Only for EJX530A and EJX630A.

*3: When electrical connection code 7 or C is selected, a blind plug is protruded up to 8 mm(0.31 inch) from the conduit connection.

*4: When option code PP is selected, a blind plug is attached to the conduit connection on both sides.

• Terminal Configuration

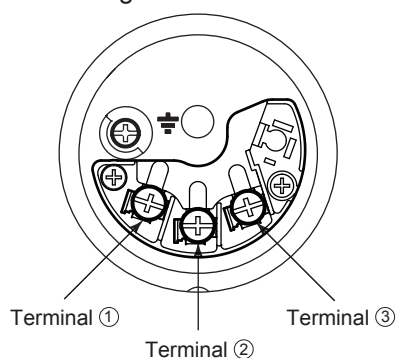

• Terminal Wiring

SUPPLY	+	①	Power supply and output terminals
CHECK	+	③	External indicator (ammeter) terminals*1*2
or	-	②	or
ALARM	+	③	Status contact output terminals*2
	-	②	(when /AL is specified)
		⏏	Ground terminal

*1: When using an external indicator or check meter, the internal resistance must be 10 Ω or less. A check meter or indicator cannot be connected when /AL option is specified.

*2: Not available for FOUNDATION Fieldbus and PROFIBUS PA communication types.